



# Confidential Report

**Our Ref: 25/05820A/02/14**

Notified Body  
for PPE Directive,  
Construction Products  
Regulation & Marine  
Equipment Directive  
I.D. No. 0338 & 0339

British Carpet Technical Centre  
Wira House, West Park Ring Road,  
Leeds, LS16 6QL

Tel No: +44 (0)113 2591999 Fax No: +44 (0)113 2780306



1066



**BCTC**

CARPET TECHNICAL CENTRE

British Carpet Technical Centre  
Wira House  
West Park Ring Road  
Leeds, LS16 6QL  
England

Tel: +44 (0)113 259 1999  
Fax: +44 (0)113 278 0306  
Web: <http://www.bttg.co.uk>  
Email: [CSLeeds@bttg.co.uk](mailto:CSLeeds@bttg.co.uk)

6 March 2014

Our Ref: 25/05820A/02/14  
Your Ref:

Page 1 of 4

Client: Carpets International Thailand  
2054 New Petchburi Road  
Bangkapi  
Huaykwang  
Bangkok 10310

Job Title: **Sound Absorption and Impact Sound Transmission Tests on One Sample of Carpet Tile**

Clients Order Ref: --

Date of Receipt: 24 February 2014

Reference: **100% Nylon SDN Machine Tufted Carpet (Ecosoft Backing)**  
Description of Sample: Loop Pile  
Cushion Backed  
Tufted Carpet Tiles  
Measurements: 50cm x 50cm

Work Requested: BCTC were requested to carry out a Sound Absorption and Impact Sound Transmission Tests on the sample of carpet tiles supplied.





6 March 2014

Page 2 of 4

Our Ref: 25/05820A/02/14  
Your Ref:

**Carpet International Thailand**

**Random Incidence Sound Absorption Coefficient**

The sample was laid to cover an area measuring 3m x 4m directly on the concrete floor of the test facility.

The tests were carried out in a large reverberation chamber. The room has been designed with hard surfaces and non-parallel walls to give long empty room reverberation times with uniform decays. It has the shape of a truncated wedge. In addition, 11 plywood panels, each panel 1.22m x 2.44m, were hung in the room to improve the diffusivity of the sound field. The test sample was placed in the centre of the floor. The excitation signal comprised wide band random noise played into the room via a loudspeaker mounted in a cabinet facing a corner. The sound was monitored at each of 6 microphone positions. The room is 7.4m long x ~6.6m wide x 4.5m high. It has a volume of 220m<sup>3</sup> and a total surface area of 224m<sup>2</sup>. The volume of the room permits a maximum sample size of 12.79m<sup>2</sup>, in accordance with Clause 6.2.1.1 specified in BS EN ISO 354:2003, "Acoustics - Measurement of sound absorption in a reverberation room".

The procedure followed that detailed in BS EN ISO 354:2003. Measurements were made on the rate of decay of sound in the test chamber with and without the sample in place. The frequency range from 100Hz to 5000Hz was covered in one third octave bands. An average reverberation time was taken from 5 decays at each of 6 microphone positions for each of two loudspeaker positions (i.e. 60 decays per third octave band). The decays were produced by exciting the room with amplified wide band random noise and stopping the excitation once the chamber became saturated. The time taken for the sound to decay by 20dB is measured and tripled to give the reverberation time. The reverberation time was obtained from the arithmetically averaged decays at each frequency. The measurements with and without the sample in the room were carried out consecutively to avoid significant changes in relative humidity and temperature which influence air absorption at higher frequencies.

For most purposes the absorption coefficient at each octave interval is sufficient and these are given in the following table.

<u>Frequency</u> (Hz)	<u>Average Absorption Coefficient</u> (1/1 Octave)
100 - 160	0.00
200 - 315	0.05
400 - 630	0.40
800 - 1250	0.30
1600 - 2500	0.30
3150 - 5000	0.40

**Noise reduction coefficient (250 - 2000 Hz) is 0.30**

**Classification: D**





**BCTC**  
CARPET TECHNICAL CENTRE

British Carpet Technical Centre  
Wira House  
West Park Ring Road  
Leeds, LS16 6QL  
England

Tel: +44 (0)113 259 1999  
Fax: +44 (0)113 278 0306  
Web: <http://www.btg.co.uk>  
Email: [CSLeeds@btg.co.uk](mailto:CSLeeds@btg.co.uk)

6 March 2014

Page 3 of 4

Our Ref: 25/05820A/02/14  
Your Ref:

### **Carpet International Thailand**

#### **Improvement of Impact Sound Insulation**

The measurements were made in a large reverberation chamber at the University of Salford. The walls of the test room are 330mm thick and are constructed from Accrington Brick. The floor plan of the room has the shape of a truncated wedge with one pair of parallel walls and one pair of no-parallel walls. The floor and ceiling are parallel and the room surfaces are painted throughout. The test sample was placed on a 3.4m x 3.4m x 140mm thick reinforced homogeneous concrete floor slab which is inserted into the roof of the chamber. The chamber contains 11 randomly orientated plywood diffusing elements to provide a uniform diffuse sound field.

The procedure followed that detailed in BS EN ISO 10140-3:2010 "Acoustics, Measurement of sound insulation in buildings and of building elements – Part 3: Measurement of the impact sound insulation" A standard tapping machine with metal tipped hammers and conforming to Annex E of BS EN ISO 140-5:2010 was used as the impact sound source. The impact sound pressure levels ( $L_i$ ) produced by the tapping machine in the reverberant room below were measured both with and without the test specimen installed, as detailed in Annex H of BS EN ISO 10140-1.

The sound pressure levels produced by the tapping machine in the receiving room were measured at 6 microphone positions for each of 3 different positions of the tapping machine and an average level was obtained at each of the one-third octave frequency bands in the range 100Hz to 5000Hz. An averaging time of 16s was used at each microphone position. The microphone positions were chosen such that the distance between positions and between any microphone and a room boundary or sound source exceeded 1m. The distance between any microphone and diffusers exceeded 0.7m. The microphones were distributed around the room so as to cover the space uniformly.

Five reverberation time measurements were also made at each of the 6 microphone positions and at each of the 2 loudspeaker positions and the results averaged.





6 March 2014

Page 4 of 4

Our Ref: 25/05820A/02/14  
Your Ref:

**Carpet International Thailand**

The results are given in the following table.

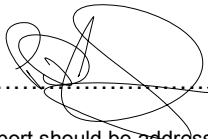
<u>One-third Octave Band Centre Frequency (Hz)</u>	<u>Improvement In Impact Sound Insulation (dB)</u>
100	5.3
125	7.6
160	11.2
200	13.9
250	21.9
315	28.5
400	32.2
500	29.7
630	39.4
800	39.5
1000	50.2
1250	55.0
1600	56.7
2000	58.4
2500	58.0
3150	60.7
4000	61.7
5000	63.2

? Correction of background  
\* Background too high

Improvement of impact sound ( $\Delta L_w$ ) = 29 dB

Note

Tests subcontracted to The University of Salford, UKAS testing no. 1262.

Reported by:  P Doherty, Operational Head

Enquiries concerning this report should be addressed to Customer Services.

