ATTAR TEST REPORT NUMBER: 14/8106.23



The results of the tests, calibrations and/or measurements included in this document are traceable to Australian/national standards.

Accredited for compliance with ISO/IEC 17025.

Accreditation Number: 2735

12 August 2014

Total Pages: 2

Job No: M14/8106

WET PENDULUM SLIP RESISTANCE

Prepared for:	Tarkett Australia Pty Ltd						
	16 Anella Avenue						
	CASTLE HILL NSW 2154						
Attention:	Maria Barreto-Tilman						
Test Site:	Test Slip Australia Pty Ltd, Beaumont Hills, NSW.						
Test Date:	12 August 2014						
Test Specimens, Size &	Granit Multisafe sheet vinyl, 300mm x 300mm,						
Quantity:	5 off.						
Sampling & Direction of Testing:	Sampling conducted by client. Testing carried out at						
	45° to profiled pattern. Refer to Figure 1.						
Test Personnel:	Clark Ahearn						
Preparation:	Washed with water and pH neutral detergent, rinsed						
	with water, then dried.						
Fixed/Unfixed:	Fixed.						
Air Temperature:	20°C						
Test Equipment:	Wessex Skid Resistance Tester (Pendulum) Serial						
	Number SK 1818, Calibrated 29/07/2014.						
Test Standard:	AS 4586: 2013 Slip resistance classification of new						
	pedestrian surface materials – Appendix A.						
Slider Rubber:	Slider 96 Batch No. #53 prepared on P400 & 3µm						
	lapping film.						
Classification Criteria:	Refer to Classification Criteria, attached as Appendix 1.						
	Specimen Number					ODV	
British Pendulum Number	1	2	3	4	5	SRV	
	42	44	42	44	44	43	
Classification:	P3						

These results apply only to the specimens tested and it is recommended that before selection of flooring or paving materials the effect of service conditions, including maintenance procedures and wear on their slip-resistance be checked.

NOTE: Any specimens supplied will be disposed of in two (2) months time, unless otherwise instructed.

ATTAR

Marcus Braché

Senior Engineering Technician

Approved Signatory

This report may not be reproduced except in its entirety.



ATTAR TEST REPORT NUMBER: 14/8106.23

12 August 2014 Total Pages: 2

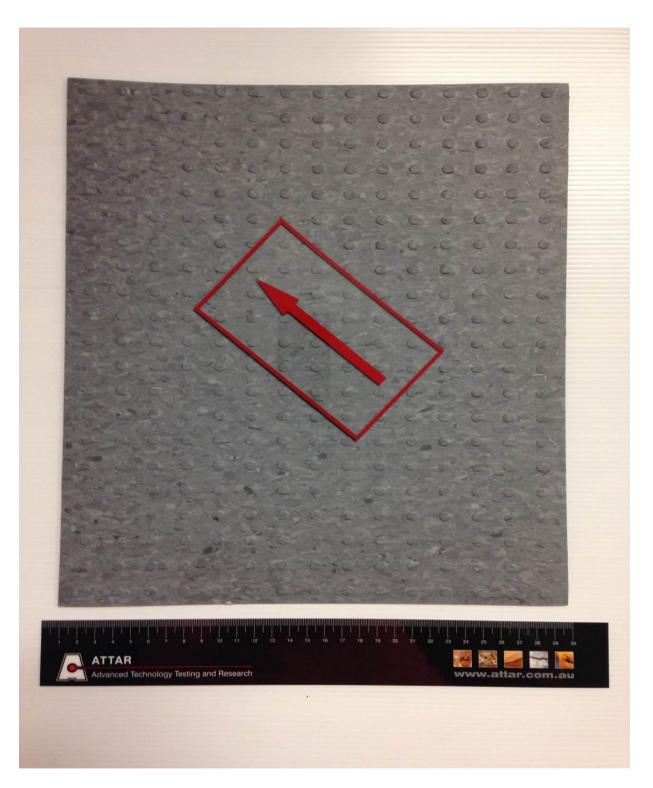


Figure 1: Granit Multisafe – Highlighted area indicates area tested and direction of test.

This report may not be reproduced except in its entirety.